
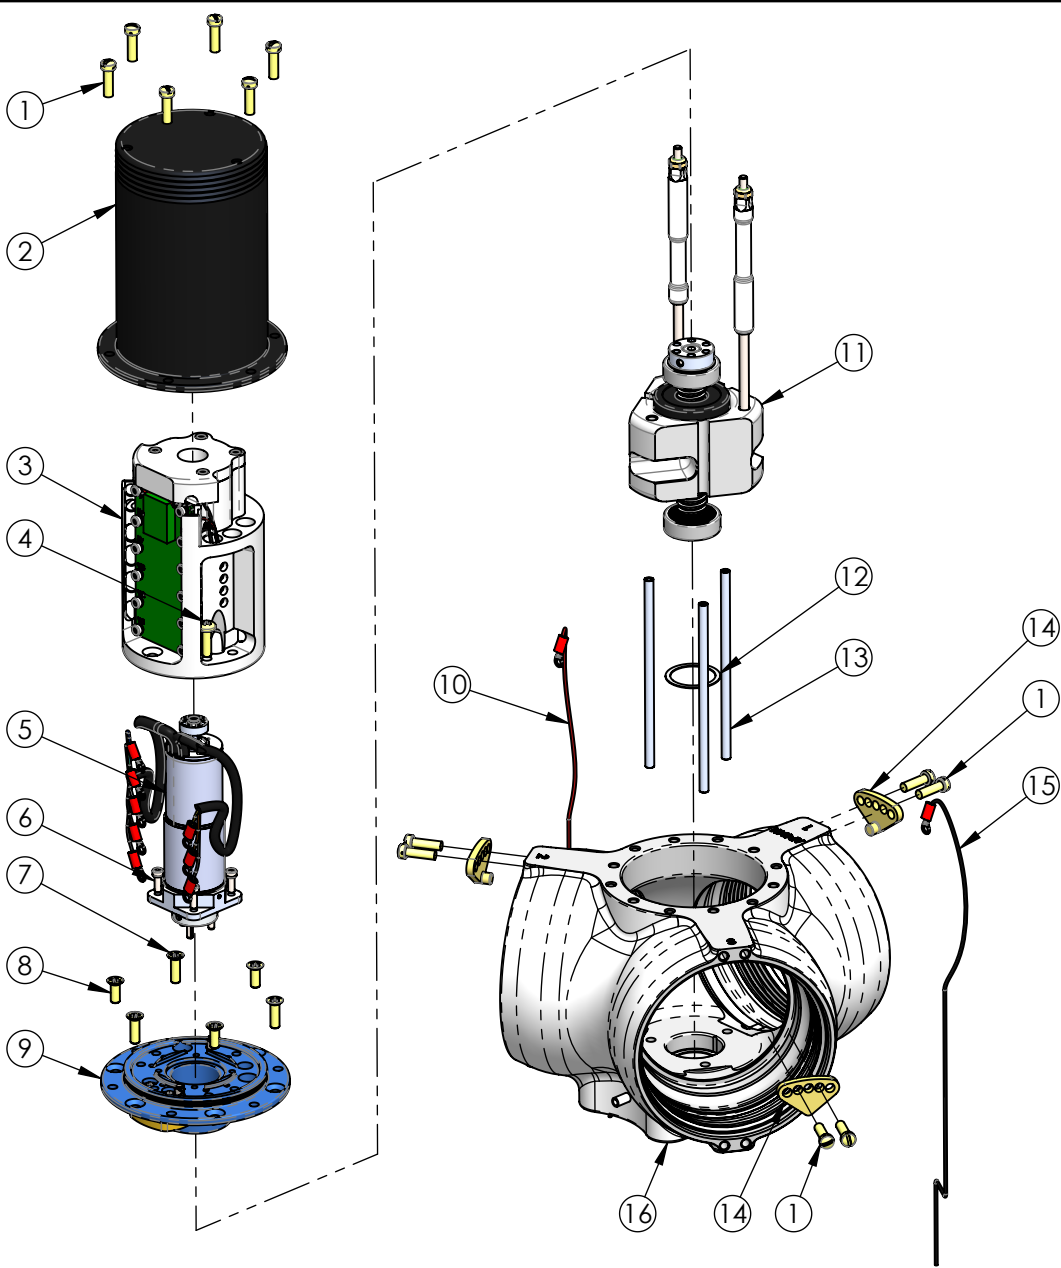


ITEM NO.	QTY.	PART NO. ASSY NO.	DESCRIPTION	REV
1	12	P0107	Phillister Hd Screw, 10-32UNF x 5/8"(MS35266-64)	
2	1	P0218	Motor Cap	2
3	1	A0150S	Microswitch Mount-Brushless Standard Assy	2
4	3	P0469	Pan Head Screw, non-structural, 10-32UNC x 5/8"	
5	1	A0456-190	Maxon Gearmotor-Brushless (190:1-12V) Assy	2
6	4	P0114_SS	Cap Screw, 6-32UNC x 3/8" SS	
7	3	P0477	Csk Screw, 10-32 x 5/8 UNF (MS24693-273)	
8	3	P0477_12	Csk Screw, 10-32 x 1/2 UNF (MS24693-272)	
9	1	A0450B	Motor Mount Plate Assy - DSD	1
10	1	A0342R400	Prop Power Wire Red-Brushless (400mm) Assy	1
11	1	A0467B	Pitch Change Assy 3P CW Feathering DSD	1
12	1	P0160-0.5	Shim, Drive Spindle (0.5mm)	2
13	3	P0238	Wire Guide Tube	1
14	3	P0442	RN Securing Plate	2
15	1	A0342B400	Prop Power Wire Black-Brushless (400mm) Assy	1
16	1	A1431H	Hub Basic 431-Rotax Assy-High Power	2

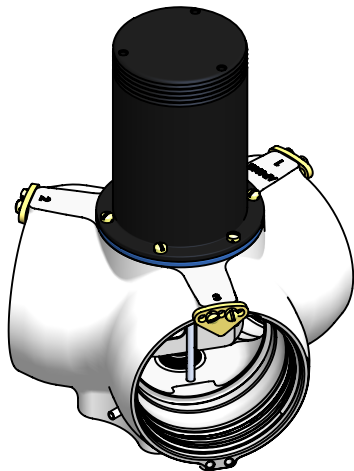

ASSY FILE: AH-4 Hub Assy	REV: 1D	1D A0456 to R2, A0150S to R2	16/05/25	BOM	 Airmaster Propellers Ltd 20 Haszard Rd, Massey PO Box 374, Kumeu Email: support@propellor.com Auckland, New Zealand Web: www.propellor.com
DRG FILE: AH-431HCF(i30-190) Hub Assy		1C A0150S to R1A	04/04/25		
ASSY NO: AH-431HCF(i30-190)		1B A0456-190 to R1A	10/03/25		
DESCRIPTION: AP431 Hub Assy-CW, Feathering DSD		1A A0451B replaced by A0450B	20/01/25		
		1 Original	12/08/24		
		REV DESCRIPTION	DATE	COPYRIGHT RESERVED ©	The information contained in this drawing is the sole property of Airmaster. Any reproduction in part or whole without written permission of Airmaster is prohibited.